Technical Bulletin




Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Rabbit, GTI	2007	All	All	1K_7W000001	1K_7W206473

Condition

96 07 01 May, 25 2007 2015105

Driver Door, Central Locking -Safe- Indicator Lamp -K133- Remains Illuminated

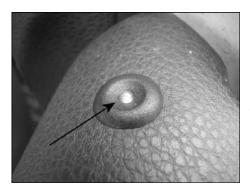

After unlocking the vehicle with the remote control, the LED remains illuminated. Illumination may also occur while operating the vehicle.

U Note:

Central Locking Indicator Lamp -K133- illumination **has no effect on functions** of central locking or the alarm system. The concern is with the LED control circuit only.

Technical Background

If door is unlocked by remote control at the same time as the LED flashes, the LED may illuminate and stay on.

Concern is due to a software fault in the door control module.

Production Solution

Updated door control module software from February 2007.

Part number	Old SW version	New SW version
1K0959701N	0972	0986

© 2007 Volkswagen of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

Technical Bulletin



Service

i Tip:

LED goes out and LED returns to normal operation when vehicle is locked with the remote key.

• Install driver door control module Part No. 1K0959701N with updated software level 0986 to correct the concern. See Repair Manual Group 57 in ElsaWeb.

Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual				
Claim Type:	See the Warranty Policies and Procedures manual for the appropriate Claim Type**			
Part Identifier:	6454			
Damage Code:	6454 40* 2			
Labor Operation: Remove and Install Door Panel	70591900 = 40 TU			
Labor Operation: Replace Door Module	64541960 = 10 TU			
Diagnostic Time:	Diagnostic time reimbursement follows guidelines printed in the Volkswagen Policies and Procedures Manual			
Claim Comment: Input "As per Technical B	ulletin 2015105" in comment section of Warranty Claim.			

* Code per warranty vendor code policy.

** Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only.

Required Parts and Tools

Description	Part No:	Quantity
Door Control Module	1K0959701N	1

See Repair Manual for Special tools required.

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

© 2007 Volkswagen of America, Inc.

Page 2 of 2

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.